

T.I. no.: 2020 - 17 Updated: -	Topic: Product optimisation of connector plug
---	--

Datum: 05.06.2020	Priority	Need for action
Betroffene Maschinen: Schaerer Barista	High	As soon as possible
As of date: Production 10.2016 (subsequent information)	X Medium	X On next visit to the machine
	Low	FYI only

DESCRIPTION OF THE PROBLEM


The 7-pin connector plug, which is plugged into the switching power supply at slot X 3, did not have a plug-in coding before the optimisation and can therefore be plugged in incorrectly on machines with a production date up to 09.2016. In this case the front panel of the machine is permanently damaged upon switch-on and the machine displays the error messages 9478 and 9479.

Reason for information in the field

In a few individual cases, service work resulted in a permanently damaged front panel due to an incorrect plug-in position of the 7-pin connector.

Therefore, on machines with a production date up to 09.2016, it is absolutely important that you pay attention to the correct plug-in position when plugging in the 7-pin plug again on the switching power supply:

Correct plug-in position

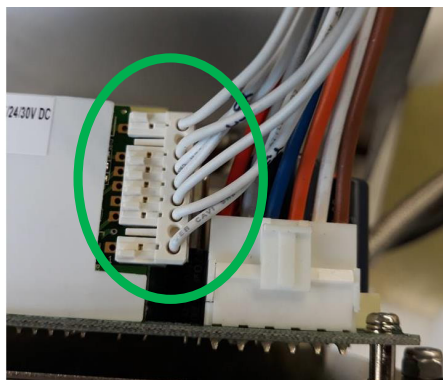

Incorrect plug-in position

