

T.I. no.: 2015 - 06 Updated: -	Topic: Software V2.14
--	------------------------------

Date: 13.04.2015	Priority	Need for action
Affected machines: SCP	High	As soon as possible
From serial number: 1512...	X Medium	X On next visit to the machine
From date: CW 12	Low	FYI only

SOFTWARE V2.14

Information for remedying faults in software version V2.14 for Schaerer Coffee Prime:

Only affects Schaerer Coffee Prime with new drip tray (produced starting in CW 34/2014).

If the SCP is operated with the "drip tray" process variant, it is possible that the capacitive sensor which monitors the filling level of the drip tray will prematurely output the "please empty drip tray" message. TI 2014-29 informed that the drip tray sensor is to be deactivated using the software.

With the new software, the delay of the sensor signal was increased from 3 to 10 seconds, thereby solving the problem of premature warnings. The drip tray can be switched on again after the software update.



The software and programming instructions can be downloaded in the Media Centre (www.schaerer.com/member) (login required).

(EN) This page is intentionally left blank.

(DE) Diese Seite wurde absichtlich frei gelassen.

(FR) Cette page est laissée vide intentionnellement.

(ES) Esta página se dejado en blanco intencionalmente.