

SERVICE MEMO

18-11-2024

Dispenser(s): *W100_Omni*
Title: Brewer Error / brewer difficult to mount


Background:

Reports are coming from the field that the brewer is not positioned correctly, the green lock on the left side is not positioned correctly and does not catch the brewer.

Action:

Operator:


When mounting the brewer, the green lock must be in front of the brewer.

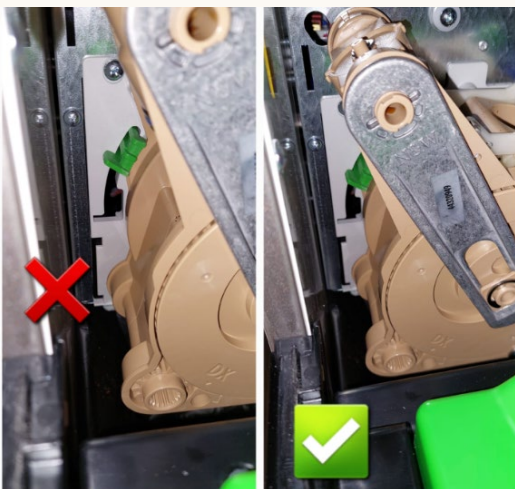


Service:

Make a finder at the point where the green handle touches the brewer. File a bevelled edge. Details see next page.


Standard:

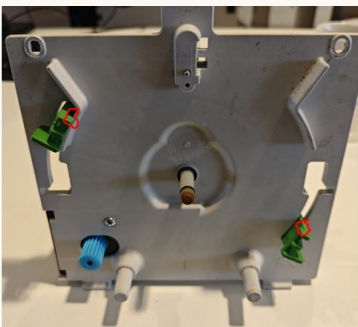

Corrected left:

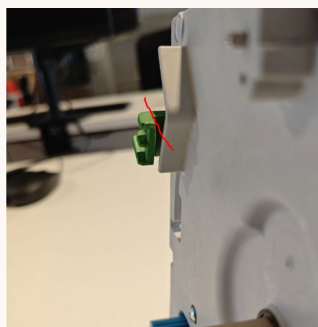

Corrected right:

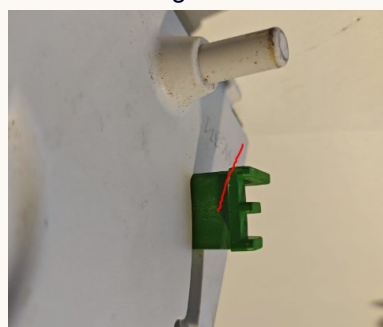

Name: J. Verdam



