

Type <b>Coffee Vending Machine</b>	Model <b>9100 - 95</b>	N° T.I. <b>03 - 2022</b>					
Serial Number <b>13521503</b>	Subject <b>OR Material modification of the NTC PROBE</b>	ISSUED FOR (X)	<table border="1"> <tr> <td>Action</td> <td></td> </tr> <tr> <td>Information</td> <td><b>X</b></td> </tr> </table>	Action		Information	<b>X</b>
Action							
Information	<b>X</b>						

**REASON:**

To avoid any hydraulic leakage

**MODIFICATIONS:**



The **OR** of the *NTC probe* has been replaced by a **new** one made of **new** material: **FKM** (instead of **EPDM**) that guarantees greater resistance to the working temperatures of the boiler.

**New OR gasket - FKM - 1,78X9,25 (green)**

Spare code: **11013173/sap 55124924**

**Pre – modific. OR gasket - EPDM - 1,78X9,25**

Spare code: **251556/sap 55116454**

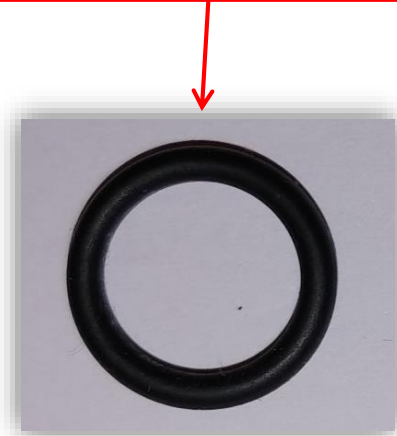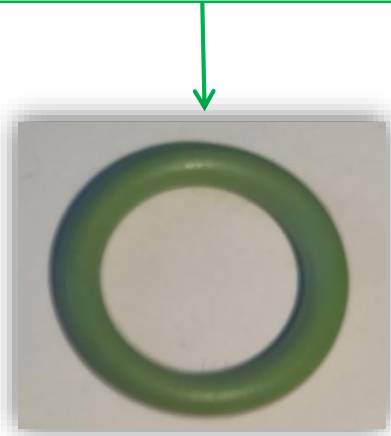

➤ **Machines concerned by modification from S/N 13521503.**

**EXCHANGEABILITY:**

The **new OR** can be used on machines previous the S/N above.

Spare part code of *NTC probe* it is not changed: **264671**