

Type Coffee Vending Machine	Model 9100 IN - 9200 CV	N° T.I. 03 - 2020
Serial Number 00721964	Subject INSTANT BOILER ASSEMBLY MODIFICATIONS	ISSUED FOR (X) Action Information <input checked="" type="checkbox"/>

REASON:


To avoid any boiler assembly hose from detaching and causing a water spill

MODIFICATIONS:

- Three hose clips** have been added on the hoses coming out from the instant boiler
- The pre-modification brown silicone hose**, connecting the instant boiler to the pump, has been replaced by a transparent silicone hose, plus a fitting and a shorter brown silicone hose.

Modification 1

New solution
boiler body + 3 hoses + **3 hose clips**

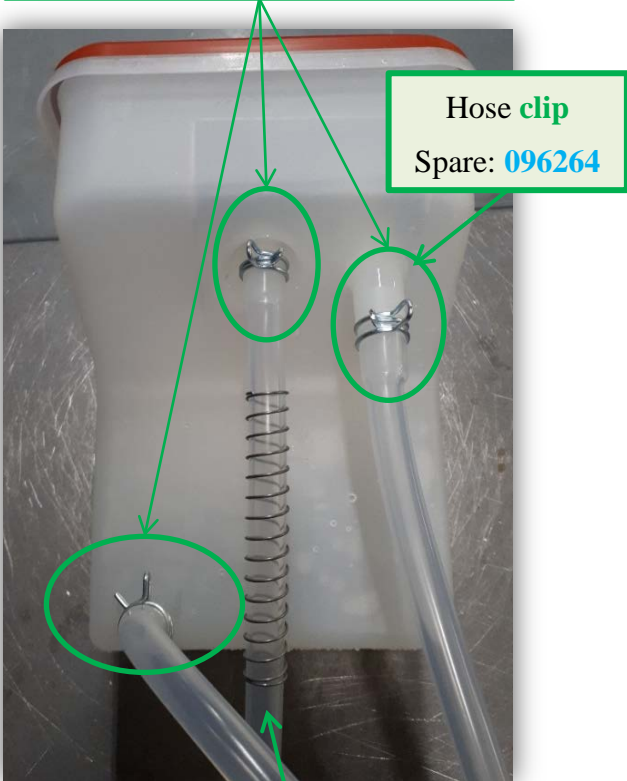

Pre-modification solution
boiler body + 3 hoses



Modification 2


Transparent silicone hose
replacing the **brown one**

Length: **260 mm**
Spare: **255541**




Type Coffee Vending Machine	Model 9100 IN - 9200 CV	N° T.I. 03 - 2020
Serial Number 00721964	Subject INSTANT BOILER ASSEMBLY MODIFICATIONS	ISSUED FOR (X) Action Information X


New solution
Instant boiler assembly

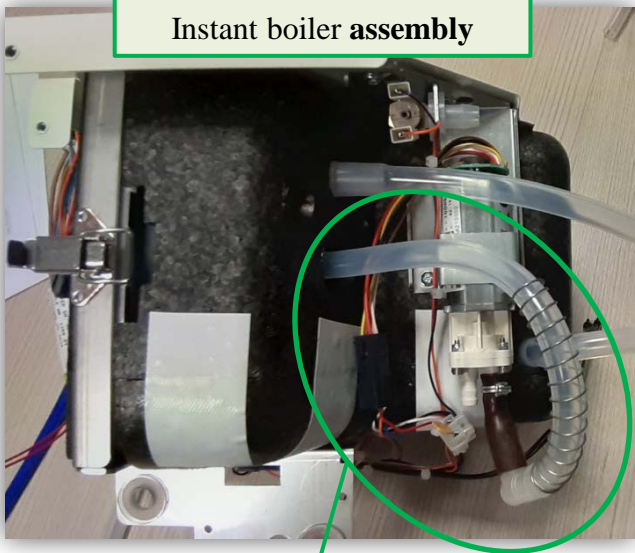

Pre-modification solution
Instant boiler assembly

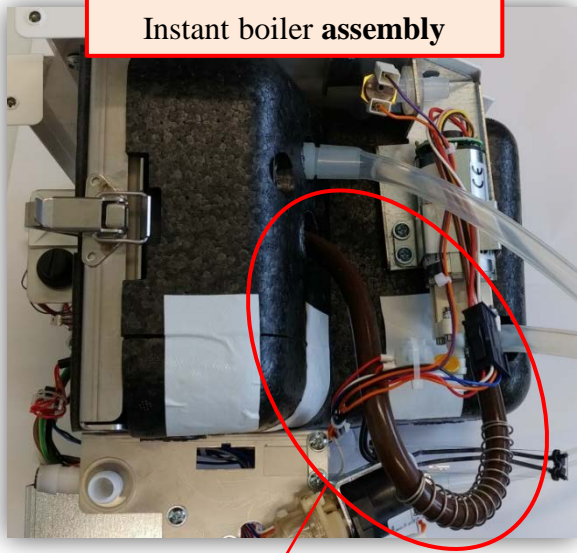


Modification 2

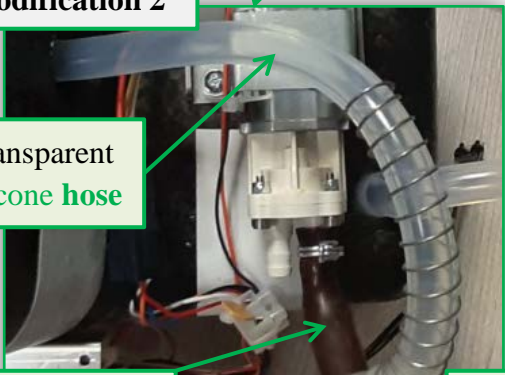

Transparent silicone hose

Shorter brown silicone hose (40 mm)
Spare: **097685**

PP elbow fitting
Spare: **39758800**

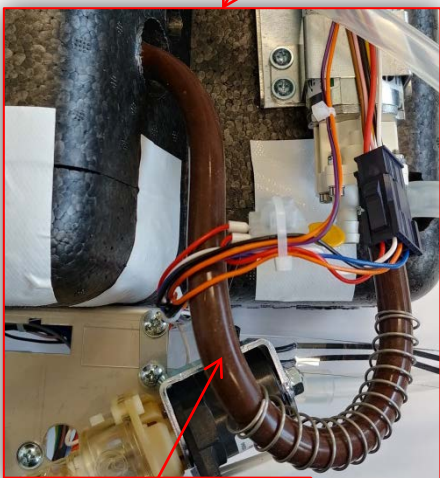

Pre-modification brown silicone hose

The instant boiler assembly spare code is not changed: **260784**

➤ Machines concerned by modification from S/N: **00721964**

EXCHANGEABILITY:

For machines previous to above S/N it si possible to use the **new** instant boiler assembly