

T.I. no.: 2019 - 11-b Updated: -	Topic: SC Soul Software 4.4.7
--	--------------------------------------

Date: 04.07.2019	priority	Need for action
Affected machines: SC Soul	X High	X As soon as possible
From serial number: 1927../	Medium	On next visit to the machine
As of date: -	Low	FYI only

NEW FUNCTIONS AND IMPROVEMENTS

IMPORTANT!
 The problem with water splashing during cleaning mentioned in the 2019-08 technical information has been fixed with software 4.4.7. The update must be installed in affected machines as soon as possible.

New functions:

- Images and animations can be displayed during beverage dispensing.
- Operator can see extraction time of the last five beverages.


Improvements:

- Display of Quick Info window optimised
- Daylight saving time is read out correctly.
- Service counter of the 30 g brewing unit works correctly.
- If the machine is blocked for > 30 min, rinsing is carried out as soon as the machine is ready for use again.
- A maximum of 12 beverages (previously 8) can now be displayed if beverage tabs are activated.
- Communication error with payment system does not trigger the grinder again.
- Milk beverages can no longer be dispensed correctly if there is a "Waste water tank full" message.
- In the hardware detection overview, the faulty components are displayed at the top.
- Steam cushion regeneration no longer leads to water in the grounds container.
- Set times for preheating or precooling of the Best Foam system are applied correctly.
- If the grinders are not connected correctly, this is detected correctly in the hardware detection.
- The beverage grid in the menu cards is adapted to the number of beverages in the respective group when using the group view.
- The post-modification "Barista" is shown and hidden correctly.
- Incorrect detection of the milk pump in the hardware detection corrected.
- Steam boiler timeout when starting the machine fixed.

NOTE
 After the update to version 4.4.7, the sequence of events in the error statistics is no longer correct. This error will be fixed in one of the next software versions.

Extraction statistics in the Operator menu

The statistics can be called up via the following menu item:

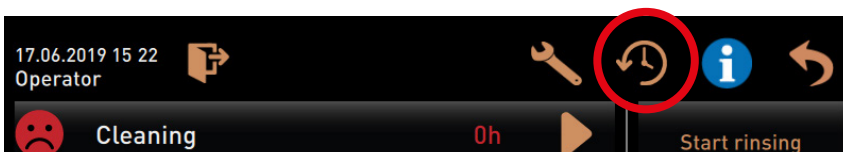

(EN) This page is intentionally left blank.

(DE) Diese Seite wurde absichtlich frei gelassen.

(FR) Cette page est laissée vide intentionnellement.

(ES) Esta página se dejado en blanco intencionalmente.