

T.I. no.: 2019 - 28 Updated: -	Topic: Product optimisation: New milk hose – 00.0048.4939
--	--

Date: 11.12.2019	Priority	Need for action
Affected machines: SC Club	High	As soon as possible
From serial number: 21971 ff	X Medium	X On next visit to the machine
As of date: -	Low	FYI only

IMPROVEMENTS

Problem/reason for optimisation:

- Milk system cleaning is sometimes insufficient due to milk hose being kinked/too thin during Click & Clean cleaning
- General improvement in operating reliability

Improvements:

Spare part

- New milk hose with spare part number **00.0048.4939** (silicone hose 4x2 black-transparent with 4 mm internal diameter / 2 mm wall) has been incorporated into series production with serial number **21971** of the SC Club.
- The increased wall thickness of the new milk hose makes it practically impossible for the hose to kink, significantly reducing the risk of backing up during Click & Clean cleaning.

Retrofitting set

- In addition to the silicone hose described above, a retrofitting set is available which can be ordered via the spare parts catalogue or the online shop
- Retrofitting set art. no. **33.2804.5000** – 2x silicone hose 4x2 black-transparent (00.0048.4939) and 1x supplementary sheet (33.4322.2000)

Spare parts and pipe diagrams have been updated.

TECHNICIAN INFORMATION


On your next visit, please inform the customer that the milk hose on a Schaerer Coffee Club must always be used with a Plug & Clean adapter and that the hose must always be pushed fully over the connection nipple of the Plug & Clean adapter. Further information is provided below.

REPLACING THE MILK HOSE



Old: "Transparent" milk hose

Art. no.: 00.0048.4948

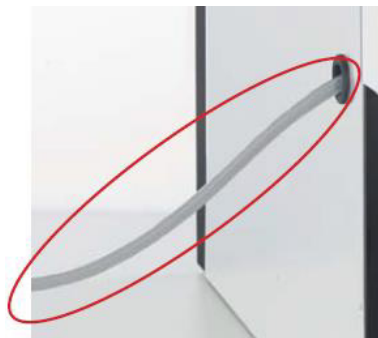

New: "Black-transparent" milk hose

Art. no.: 00.0048.4939

The new hose is black-transparent rather than just transparent in order to prevent mix-ups. Old "transparent" hoses (art. no. 00.0048.4948) in the field should be replaced with the new "black-transparent" hose (art. no. 00.0048.4939) as soon as possible, at the latest by the next due date. The recommended interval for replacing the milk hose is 6 months; see operating instructions. The old "transparent" hoses must no longer be used on the SC Club after this point!



Plug & Clean adapter

Adapter

The Plug & Clean adapter can still be used. The adapter must be removed from the transparent hose and fitted on the new hose. Please make sure that the milk hose is connected correctly – the hose must be pushed over the adapter as far as it will go; see figure on left.