

T.I. no.: 2016 - 07 Updated: -	Topic: Best Foam™ hardware adjustments
---	---

Date: 15/07/2016
Affected machines: SCA P Best Foam™
From serial number: 1607-xxxxxx
As of date: -


Priority
High
X Medium
Low

Need for action
As soon as possible
X On next visit to the machine
FYI only

PROPORTIONAL VALVE PLACEMENT

The placement of the proportional valve has been changed from horizontal to vertical to prevent deposits from forming. The original position caused increased deposits in the valve when water hardness was high (>10° dKH). These deposits can lead to fluctuations in temperature. Deposits are prevented by vertical placement.


This change is recommended for machines which are exposed to highly calcified water (>10° dKH).

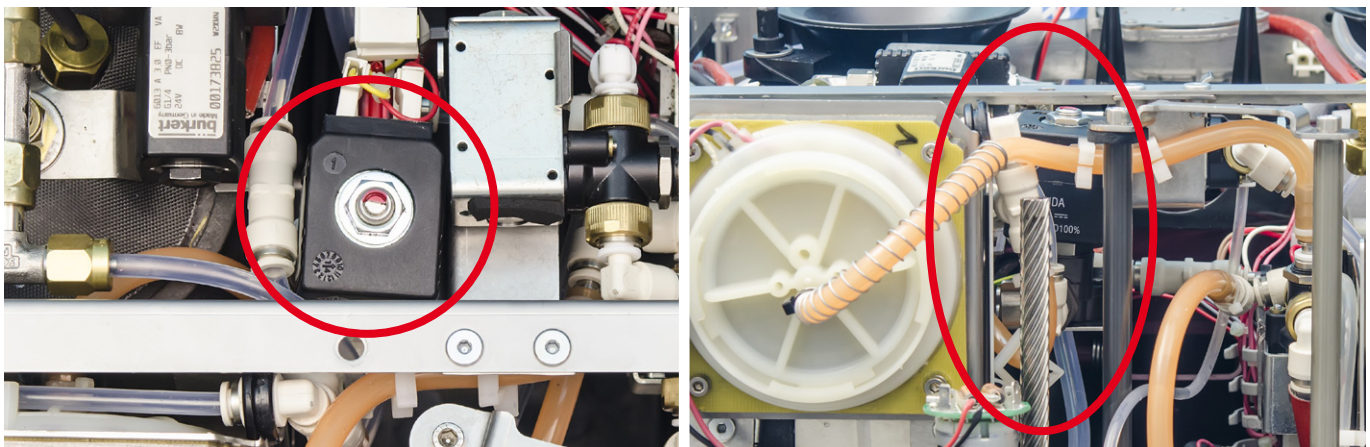

NON-RETURN VALVE IN AIR PATHWAY

A non-return valve is installed in the air pathway to prevent humidity in the air pump.

This change is recommended. Kit 073'720 can be obtained from Schaeerer AG for free until 30/9/2016.

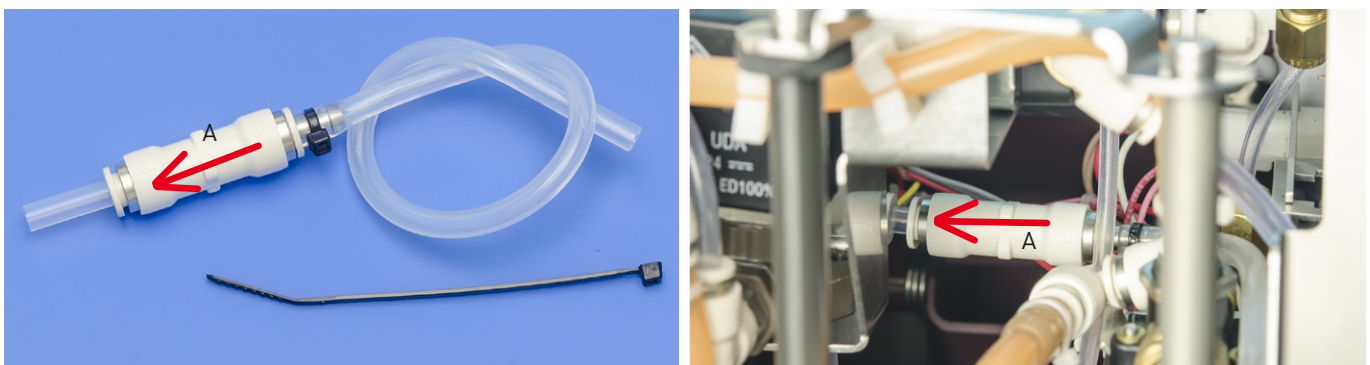

(EN) This page is intentionally left blank.

(DE) Diese Seite wurde absichtlich frei gelassen.

(FR) Cette page est laissée vide intentionnellement.

(ES) Esta página se dejado en blanco intencionalmente.