

T.I. no.: 2021 - 03 Updated: -	Topic: Mounting bracket for grinder cover
-----------------------------------	---

Date: 08.03.2021	Priority	Need for action
Affected machines: SCP	High	As soon as possible
From serial number: 2023../	Medium	X On next visit to the machine
As of date:	X Low	FYI only


IMPROVEMENTS

Grinder cover fastened with PT screw

Grinder cover 072 901 of the Schaeerer Coffee Prime was previously fastened with two push rivets 073 657. The lower push rivet did not sufficiently perform its holding function and frequently fell out.

From serial number 2023/XXXX, lower push rivet **073 657** will be replaced by PT screw **068 807**. The upper push rivet remains unchanged.

PU screw **068 807** is self-tapping and can be screwed into the existing hole.

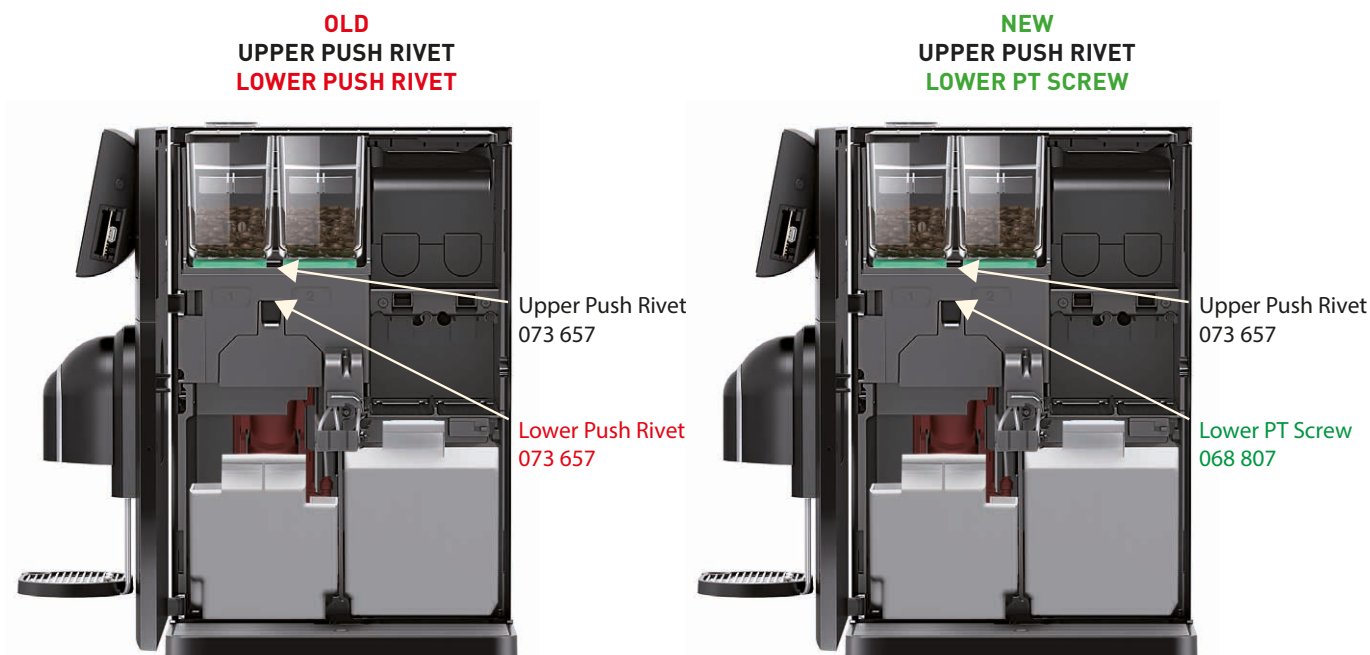

Disassembling grinder cover

NOTE

To avoid damage to the grinder cover during disassembly, observe the following sequence

- ▶ Pull out brewing unit holder drawer **pos. 3**
- ▶ Remove push rivet **pos. 1** and PT screw **pos. 2**

