

T.I. No.: 2022-11 Update:	Thema: Change of material - brewing unit 16g „brown“
-------------------------------------	---

Date: 12.04.2022	Priority	Need for action
Affected machines: SC Club	High	As soon as possible
From serial number: -	Medium	On next visit to the machine
As of date: immediately	x Low	x FYI only

REASON FOR CHANGE

The previously used plastic material of the "brown" brewer, which was used for all brown brewer parts, can no longer be provided by the supplier and therefore the change to a new plastic material is required.

As this change also concerns the spare parts supply for all "brown" brewers in the field (previous plastic material AND future plastic material), a new brewer "spare part kit" will be introduced in addition to the complete spare part brewer.

This change only affects the "brown" brewer parts, the black brewer parts such as spindle, ejector and lower friction piston are not affected by this material change

Serial and Spare Part Solution

With the following serial numbers the new brewer "brown" was delivered together with a SCclub:

58991-58993, 59002, 59004, 59006-59008, 59011, 59013-59016, 59021-59023, 59025-59029, 59031, 59033, 59034, 59038, 59039, 59041-59043, 59045, 59048, 59050, 59052, 59057-59062, 59064, 59071, 59072, 59074, 59076, 59077, 59081, 59111, 59112, 59114-59125, 59128, 59129, 59134-59136, 59138, 59140-59148, 59150, 59151, 59167, 59168, 59170-59175, 59177-59186, 59188, 59193, 59227, 59241, 59246, 59247, 59550, 59552, 59554-59556, 59589, 59596, 59601, 59603, 59604, 59606-59608, 59612, 59614, 59616, 59618, 59619, 59623, 59627, 59629, 59637, 59639, 59641, 59643, 59647, 59652, 59654, 59655, 59657, 59670, 59672-59676, 59678, 59679, 59680, 59687, 59688, 59696, 59699, 59701-59703, 59706, 59715, 59720, 59721, 59723, 59727, 59755, 59765, 59766, 59773-59795 and following.

In case of repair, a "spare part kit" will be available in addition to the complete spare part brewing units in the future:

- 33.4751.2000 – spare part kit „Brewing cylinder with brewing piston cpl.“
- 33.2893.0399 – spare part brewer „brown“ complete for Schaerer Coffee Club

The following previously available brewer spare parts of the brewer "brown" can no longer be ordered:

- 33.2891.4000 – lower piston
- 33.2891.5199 – upper spout piston cpl.

Advice for Technicians


Concerning the identifying features of the new brewer "brown" as well as the scope and handling of the new spare part kit, please absolutely observe the notes on the following page.

Identifying feature brewer „brown“ with new plastic material

Individual brewer parts or a complete brewer "brown" made of new plastic material can be recognized by the following features:

- > Slightly reddish color which differs from the brown of the original „brown“ brewer
- > Brewer serial number (glued-on type plate)

Notice: Do not confuse with the "red" brewer from SAG!

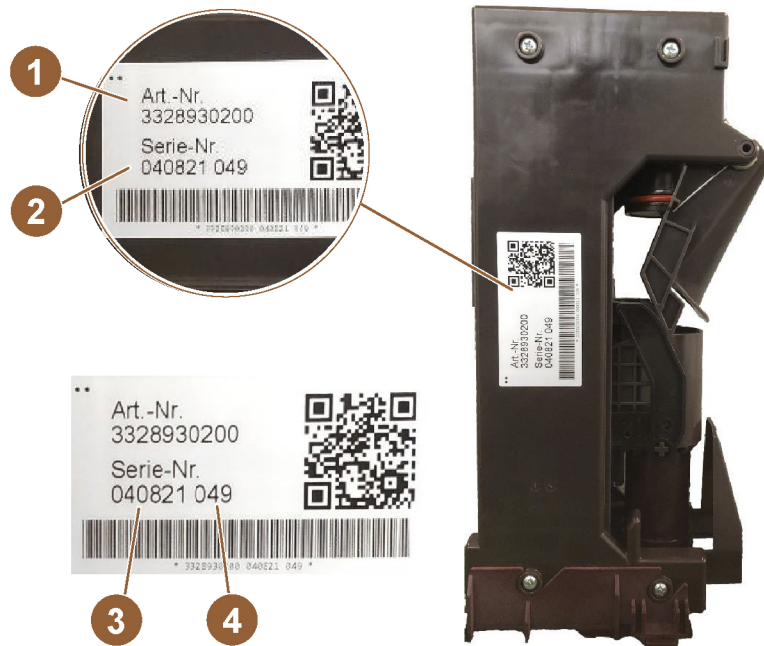

Pos.-No.	Naming	Description
[1]	Item-No.	The item numbers on the type plate of the brewer differ depending on the brewer version and determine the intended use for which machine type the brewer is used as a basic brewer. 33.2893.0200 Brewing unit SCClub
[2]	Serie-No.	Serial number of the brewing unit is a consecutive number (example 040821 049)
[3]	Coding 1. Block	04 = Day of week 08 = CW 21 = Year
[4]	Coding 2. Block	049 = Consecutive number per weekday

Spare part kit – 33.4751.2000

The precise matching and the fitting accuracy between the lower piston and upper spout piston in combination with the brewing cylinder is very important for the permanent and perfect function of the brewing unit!

In order to assure this precision also after repairs and to avoid mixing of individual brewer parts made of the previous plastic material on brewers made of new plastic material, a spare part kit is introduced.




The spare part kit may be used for ALL "brown" brewers.

However, individual brewer spare parts which are made of the old plastic material must NOT be fitted in "brown" brewers made of the new plastic material (as of brewer serial number - 035021 006).

Notice

Please note that no individual brewer spare parts may be installed from the brewer „red“ (SAG) into the brewer „brown“. Mixing the parts will lead to malfunctions in the brewer.

The spare part kit consists of the following parts

Upper spout piston (with brew panel and piston o-ring)	Brewing cylinder	Lower piston (with piston o-ring)
		

Service Contact

Global Technical Support Team

GBU Professional Coffee Machines

- > Support Hotline: +41 32 681 62 75 (10:00-11:30 CET/ 15:00-16:30 CET)
- > Support E-Mail: technical-support@schaerer.com