

<b>T.I. no.:</b> 2023-23 <b>Updated:</b> -	<b>Topic:</b> Pump Bypass Repair Set
---	--------------------------------------

<b>Date:</b> 24.11.2023	<b>Priority</b> <input type="radio"/> High <input type="radio"/> Medium <input checked="" type="radio"/> Low	<b>Need for action</b> As soon as possible On next visit to the machine FYI only
<b>Affected machines:</b> Schaerer Barista		
<b>From serial number:</b> -		
<b>Start date:</b> immediately		

## Reason for change

A repair set is now available for the pump head of the espresso pumps of the machines named above.

33.4512.0000 Pump bypass repair set



Figure 1: Contents of repair set

The repair set can be used to avoid replacing a complete pump or pump head if the following fault patterns occur:

- Leakage at the adjusting screw or cap nut
- Pump pressure cannot be set correctly.
- Pump pressure fluctuates heavily.

## Installation of repair set

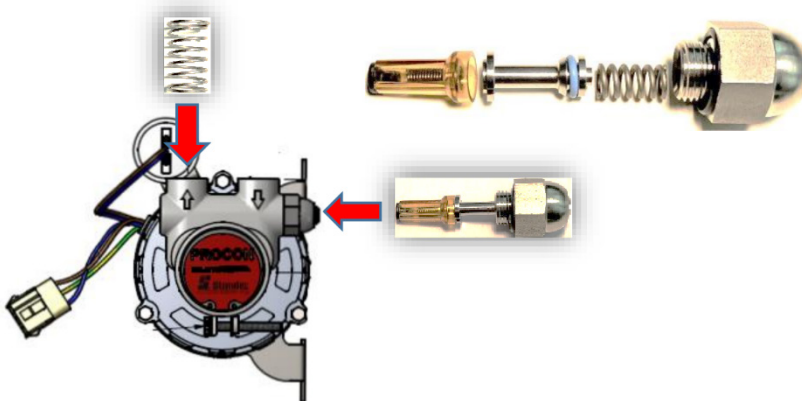


Figure 2: Installation of repair set

We recommend applying a light coat of the grease for sealing rings (Molykote 111 / article number 33.2179.9000) to the two O-rings when installing the repair set.

<b>Service contact</b> Global Technical Support Team GBU Professional Coffee Machines > Support hotline: +41 32 681 62 75 (10:00-11:30 a.m. CET/ 3:00-4:30 p.m. CET) > Support e-mail: technical-support@schaerer.com
---