

Type <b>Coffee Vending Machine</b>	Model <b>95</b>	N° T.I. <b>06 - 2023</b>
Serial Number <b>24024490</b>	Subject <b>CAPACITIVE KEYBOARD WITHOUT GIGABIT PORT</b>	ISSUED FOR (X) Action Information <b>X</b>

**REASON:**


Due to shortage of the Gigabit Ethernet modules present on the current capacitive keyboards

**MODIFICATIONS:**


Since the Ethernet connection is now little used unlike Wifi and 4G solutions, the *Ethernet port* and its *chip* have been removed from the CPU board, contained in capacitive keyboards.

**Modified** capacitive keyboard (no Gigabit port)

**Pre-modification** capacitive keyboard

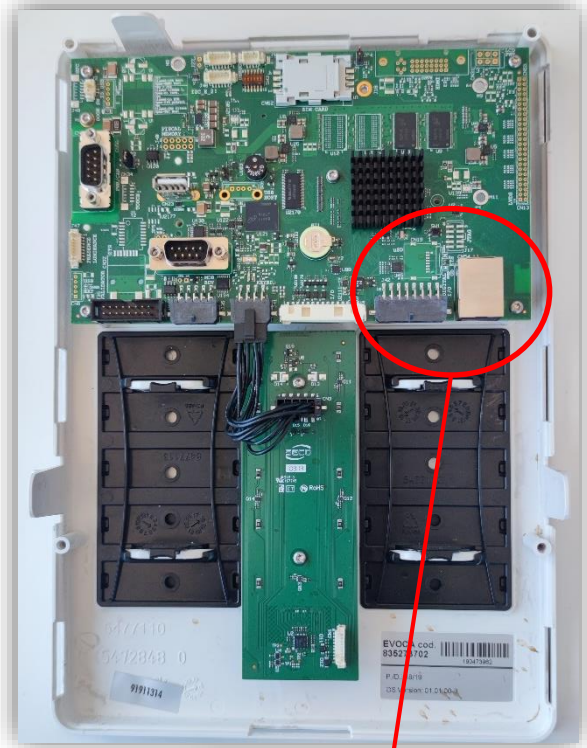


CUP board detail

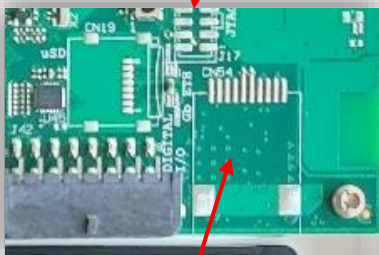

*Ethernet port*  
has been removed

CUP board detail


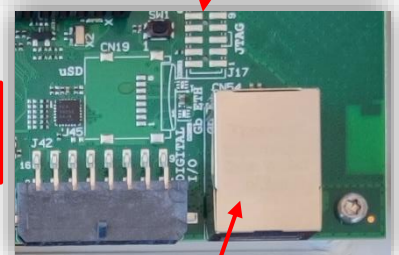


*Ethernet port*


Type <b>Coffee Vending Machine</b>	Model <b>95</b>	N° T.I. <b>06 - 2023</b>
Serial Number <b>24024490</b>	Subject <b>CAPACITIVE KEYBOARD WITHOUT GIGABIT PORT</b>	ISSUED FOR (X) Action Information <b>X</b>

**Modified** CPU board (Bottom view)

**Pre-modification** CPU board (Bottom view)

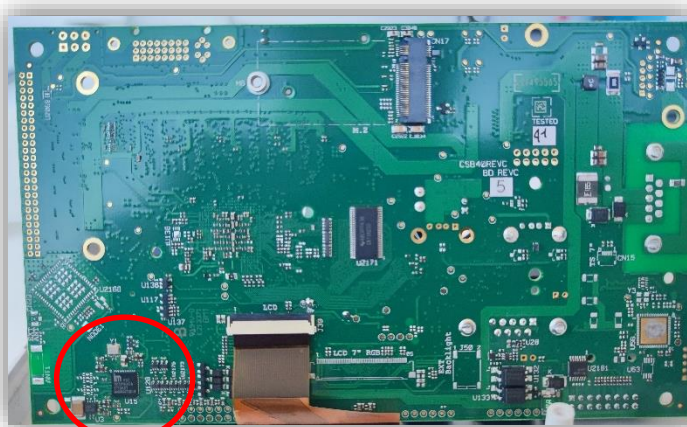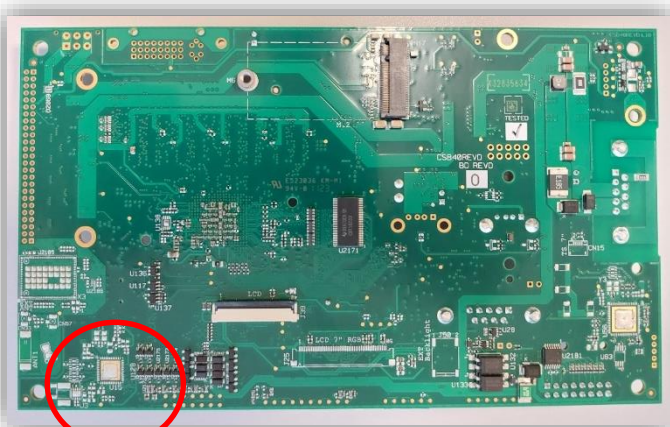

Chip removed

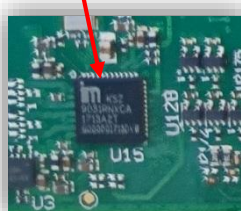

Chip

➤ Below the capacitive keyboard **codes** without and with Gigabit port

Capacitive keyboard – 6 selections -no Gigabit port

Spare part code: **265670**

Capacitive keyboard – 6 selections

Spare part code: **261667**

Capacitive keyboard – 10 selections -no Gigabit port

Spare part code: **265671 sap 55127022**

Capacitive keyboard – 10 selections

Spare part code: **262040**

➤ **Machines concerned by modification from S/N 24024490.**

**EXCHANGEABILITY:**

Capacitive keyboards without Gigabit port can be used on machines produced before S/N above.

Code **261667** will be available while stocks last.

Code **262040** is no longer available.