

<b>T.I. no.:</b> 2025-03 <b>Updated:</b> -	<b>Topic:</b> Schaerer logo display in software V2.6.1
---	--

<b>Date:</b> 2/4/2025	<b>Priority and need for action</b>	
<b>Affected machines:</b> SCCLUB	<input type="checkbox"/> High: as soon as possible	
<b>From production date:</b> -	<input checked="" type="checkbox"/> Medium: next visit	<input type="checkbox"/> Medium: change in stock
<b>From date:</b> right away	<input type="checkbox"/> Low: FYI only	

## DESCRIPTION AND SOLUTION OF PROBLEM

In **software version v2.6.1**, the Schaerer logo was not shown on the display of the SCCLUB.


We refer to our Technical Information 2024-19 (CLUB) Software V2.6.1 from 12/6/2024.

The Schaerer logo can be loaded onto the machine with a USB stick by installing **batch file SCC\_1.0.18.gz**.

Machine	Batch file	Description	Versions
<b>Schaerer Coffee Club:</b> all variants	SCC_1.0.18.gz	The batch file loads the beverage symbols, the red display line and the Schaerer logo.	From v2.6.1 and later versions.
	SCC_1.0.17.gz	The batch file loads the beverage symbols and the red display line.	From v2.2.3 to v2.4.4.

### Running batch file SCC\_1.0.18.gz

- ▶ Insert the USB data carrier.
- ▶ In the USB menu, select the **Load language** function.
- ▶ Load the **SCC\_1.0.18.gz** batch file onto the machine.

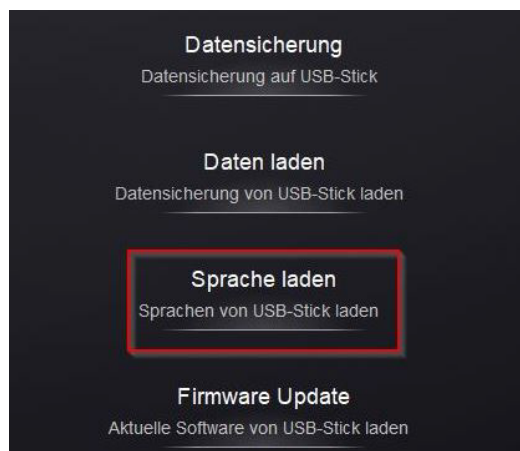

### NOTE FOR TECHNICIANS



#### Problems during or after the software update

If problems occur during or after the software update:

- ▶ Please send a data backup together with an exact description of the error in an e-mail to the contact address below.